INDEPENDENT

BATTERY CERTIFICATE

AVILOO
BATTERY DIAGNOSTICS

CERTIFICATE NUMBER: 9E57B2DD-08AF-425D-BFEF-0B78287F8563

VEHICLE

BRAND: Audi
MODEL: e-tron 55 - 95 kWh
MILEAGE: 95,778 km
VIN: WAUZZZGE2MB012340
DATE AND TIME: 02/10/2026, 09:49
EXECUTED BY: Netherlands

RESULTS

Independent
STATE OF HEALTH (SOH)

92.2 %

ENERGY 79kWh | 86kWh



WLTP RANGE 411km | 446km

RATING

BENCHMARKING
How does your vehicle compare to comparable vehicles?

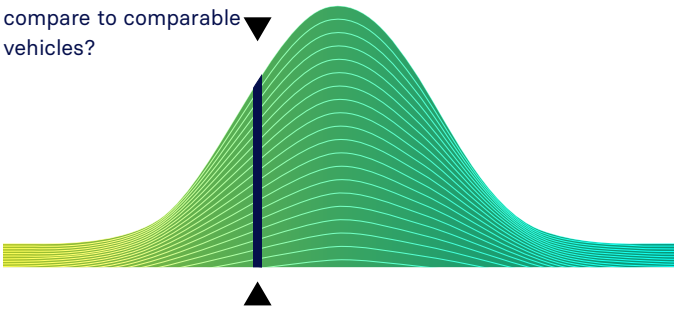

CHECKS

- Battery Management System (BMS) ✓
- Battery Sensor ✓
- Battery Measurements ✓
- Battery Cell Voltages ✓
- Vehicle Communication ✓

SCAN FOR DETAILS

EVALUATION

GOOD HEALTH - NO ABNORMALITIES DETECTED

Based on the detailed battery diagnostics performed with the AVILOO FLASH Test, we hereby certify that the drive battery of this vehicle is in good condition.

The drive battery is therefore officially AVILOO Certified.

Dr. Marcus Berger, CEO

CARA Approved Battery Health Check

BATTERY IS TESTED AND AVILOO CERTIFIED
AVILOO CERTIFIED

ENERGY

	Gross	Net (Nominal)	Usable
Current:	87.5kWh	79.3kWh	77.0kWh
New:	95.0kWh	86.0kWh	83.6kWh

RANGE

	WLTP	Typical
Current:	335-411km	289km
New:	364-446km	313km

EXECUTION PROTOCOL

AVILOO Box connected. **09:48:58**

FLASH Test started.	✓
Vehicle detected.	✓
Data acquisition started.	✓
Data acquisition completed.	✓
Data analysis started.	✓
Data analysis completed.	✓

SENSORS

Voltage Sensor	✓
Current Sensor	✓
Temperature Sensors	✓
Cell Voltage Sensors	✓

BMS

	Value	Status
BMS State of Charge (SoC)*:	96%	
SoC calculation accuracy:		✓
BMS State of Health (SoH)*:	89%	
SoH calculation accuracy:		✓

MEASUREMENTS

	Min	Max	Delta	Status
Battery Temperature	15.7°C	15.7°C	0.0°C	✓
Cell Voltage	4.093V	4.097V	4mV	✓
Pack Voltage	442.4V			
Average Current	-4.3A			

CELL VOLTAGES DIAGRAM

	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20
1 - 20	4.095	4.093	4.095	4.093	4.093	4.095	4.095	4.093	4.095	4.095	4.093	4.093	4.095	4.093	4.095	4.095	4.093	4.093	4.096	4.093
21 - 40	4.095	4.095	4.093	4.095	4.096	4.095	4.095	4.096	4.093	4.095	4.095	4.095	4.096	4.096	4.095	4.095	4.096	4.093	4.096	4.095
41 - 60	4.095	4.096	4.096	4.095	4.095	4.096	4.095	4.096	4.096	4.095	4.096	4.095	4.095	4.095	4.096	4.095	4.096	4.096	4.096	4.096
61 - 80	4.095	4.096	4.096	4.096	4.096	4.096	4.096	4.095	4.096	4.096	4.095	4.096	4.096	4.095	4.096	4.096	4.095	4.096	4.096	4.095
81 - 100	4.096	4.096	4.095	4.096	4.096	4.095	4.096	4.096	4.096	4.096	4.097	4.095	4.096	4.096	4.095	4.095	4.096	4.095	4.095	4.096
101 - 108	4.095	4.096	4.096	4.095	4.096	4.096	4.095	4.096												

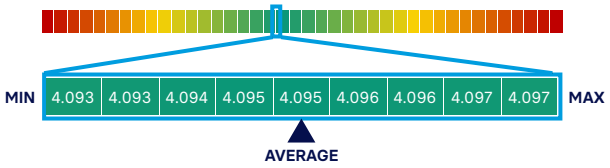

*The values shown here were read directly from the vehicle's battery management system (BMS) and are calculated and provided by the vehicle manufacturer. The State of Health (SoH) displayed corresponds to the value reported by the BMS and is CARA-certified.

DISCLAIMER: The test result includes the currently calculated state of health (SoH) of the drive battery. The determination is based on data provided by the vehicle. These are evaluated by AVILOO's algorithms using statistical and analytical models. Manipulation of the data in the control unit leads to an incorrect result. The indicated SoH has a technically induced fluctuation range (deviation) of no more than 3% in at least 95% of reference measurements. It should be noted that this tolerance applies to the SoH determination at the cell level and not to the SoH of the entire battery. This is because the state of charge of individual cells may vary, which can negatively affect the current SoH of the battery. However, this can be compensated by the Battery Management System (BMS) or during a calibration. The result reflects the condition of the battery at the time of the test. No conclusions can be drawn about the future state of health of the battery from this. Statements about mechanical damage or external influences are not part of this diagnosis.

AVILOO GmbH | IZ NÖ-Süd, Straße 16, Objekt 69/5 | 2355 Wiener Neudorf | Austria | business.help@aviloo.com

9E57B2DD-08AF-425D-BFEF-0B78287F8563